



EARTH TESTER (2/3/4 WIRES) KEW 4106 C E IGT

Earth Resistance & Resistivity Tester KEW 4106

RKYORITSU

MENU

20

200 kg 20 kg 2000 g 2000 g 2000 g

PRESS TO TEST

Earth Resistance Measurements with 4, 3 and 2 Wires Earth Resistivity (ρ) Measurement using WENNER method

- \bigcirc High test current up to 80mA yielding resolution of 0.001 $\!\Omega$ on 2Ω range
- Advanced Filtering method (based on FFT Fast Fourier Transform) reduces noise interference for obtaining stable measurements.
- Automatic and Manual selection of the Test Current Frequency in four bands (94/105/111/128Hz). In Automatic mode, KEW4106 will select the most suitable Frequency.
- Several sub-results can be shown on the display: Resistance of the Auxiliary Earth Spikes, Frequency of Test Current, Voltage and Frequency of Interference (noise), Residual Resistance Rk, etc.
- Warning for excessive noise and high Auxiliary Earth Spikes resistance.
- Large Graphic Display with backlight for readings in poorly illuminated areas.
- Up to 800 measurement results can be saved in the memory and recalled on the display.
- The stored results can be transferred to a PC using the "KEW Report" software and a USB adaptor (Model 8212-USB) which are included.
- Robust design with IP54 protection.

KYORITSU ELECTRICAL INSTRUMENTS WORKS,LTD. http://www.kew-ltd.co.jp

Earth Resistance Measurement


- Earth resistance measurement with 4, 3 and 2 wires and six ranges covering measurements from 0.03Ω to 200kΩ.
- Also ideal for large earthing systems by the considerable test current of 80mA(max) yielding a high resolution of 0.001Ω on 2Ω range.






- Advanced Filtering method (based on "FFT" Fast Fourier Transform) reduces noise interference for obtaining stable measurements.
- Warnings for excessive noise and high Auxiliary Earth Spikes resistance.


Earth Resistance Measurements with 4, 3 and 2 Wires

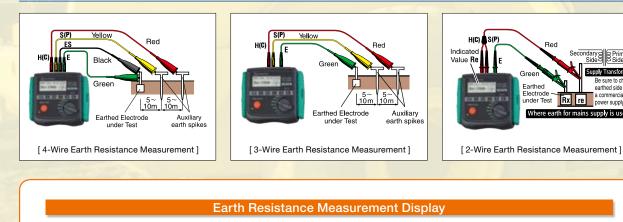

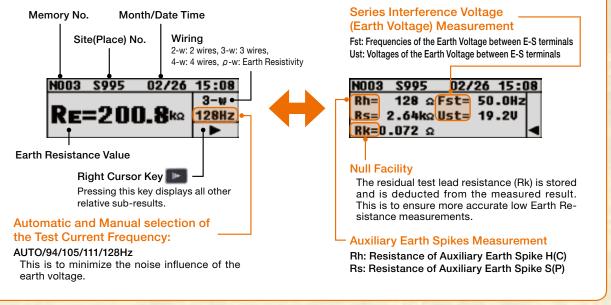

Principle of Earth Resistance Measurements

This instrument makes earth resistance measurements with fall-of-potential method, which is a method to obtain earth resistance value "Rx" by applying AC constant current "I" between the measurement object "E" (earth electrode) and "H(C)" (current electrode), and finding out the potential difference "V" between "E" (earth electrode) and "S(P)" (potential electrode).



Earth Resistivity Measurement

- The earth resistivity measurement is useful for soil surveys to establish the optimum earth electrode system design and site, to avoid extra cost of re-working electrode installations. It can be also suitable for geological investigations.
- Earth resistivity measurement is automatically calculated after having set the distance between Auxiliary Earth Spikes (Wenner method).


Measurement Method for Earth Resistivity (p)

[Connection of Auxiliary Earth Spikes and Test Leads]

Stick the four Auxiliary Earth Spikes into the ground deeply. They should be aligned at an interval of 1-30m(a). The depth should be 5% or less of the interval between the spikes.


Note) The supplied Test Leads can be used for the distance between the spikes up to 20m.






[Connection for Earth Resistivity Measurement]

Earth Resistivity (p) Measurement Display



Rg: Earth Resistance
 ρ: Earth Resistivity Value






L: Distance between Auxiliary Earth Spikes a(m)

Principle of Earth Resistivity (p) Measurements

According to the Wenner 4-pole method, apply AC current "I" between the "E" (earth electrode) and "H(C)" (current electrode) to find out the potential difference "V" between the two potential electrodes "S(P)" and "ES".

To obtain the earth resistance "Rg (Ω)", devide the potential difference "V" by AC current "I"; where the distance between electrodes is "a" (m). Then use the formula: $\rho = 2 \cdot \pi \cdot a \cdot \text{Rg} (\Omega \cdot \text{m}).$

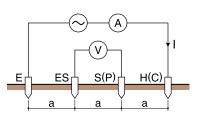

Software included (KEW Report)

The stored results can be transferred to a PC via USB adaptor (Model 8212-USB).

Up to 800 measurement results can be saved in memory.
Data can be converted to CSV files.



THE REAL PROPERTY OF	COLUMN TO A	0.0492	*1				_
the state	-	-				_	
An Allow	-	8					
and the second se	-		-	-	-	and Diff.	-
(Courseling)	-				_	-	-
10 mm 10 mm							
2 10 1000		and have					
a free fe		the loss	, April 10	Annatari	. Ander	And the local division of the local division	ð.,,
1 4 4		break sizes		1	24-1080 24-108	0.00	
		DECK DECK		0.000	Arristen .		1.
				-	Sar Line		18
Ren a	-	10100-010		12	21:127	10	
Report	-	And other Distances		100	And in the second		
			-		Sal - Lat	-	10
12 1	-	10000-0007	2010-0120	1	2:12	1	15_
Vation &		Linking (Linking)	nou term	k yes	No. 1 (1998)	-	
- t	-		-		Section Section.		17
1-	-	LAURIE CO.O.		14	10.10	_	13-
/ -	-	staniana		12	No. 1 1 (84)		
			and the second s	and the second second	Ser.		

[List of data]

KEW 4106 Specification

Function	Range	Resolution	Measuring range	Accuracy							
Earth resistance Re (Rg at <i>p</i> measurement)	2Ω	0.001Ω	0.03~2.099Ω	±2%rdg±0.03Ω							
	20Ω	0.01Ω	0.03~20.99Ω								
	200Ω	0.1Ω	0.3~209.9Ω								
	2000Ω	1Ω	3~2099Ω	±2%rdg±5dgt ^{*1}							
	20kΩ 10Ω 0.03~20.99kΩ										
	200kΩ	100Ω	3~209.9kΩ								
Auxiliary earth resistance Rh , Rs				8% of Re+Rh+Rs							
Earth resistivity ρ	2Ω		0.2~395.6Ω·m								
	20Ω	-	0.2~3956Ω·m								
	200Ω	0.1Ω·m~1Ω·m	20~39.56kΩ·m	$\rho = 2 \times \pi \times a \times Rg^{2}$							
	2000Ω	Autoranging	0.2~395.6kΩ·m								
	20kΩ 200kΩ	-	2.0~1999kΩ·m								
Series interference voltage	50V	0.1V	0~50.9Vrms	±2%rdg±2dgt (50/60Hz)							
Ust (A.C only) ^{*3}		0.414		±3%rdg±2dgt (40~500Hz							
Frequency Fst	Autoranging	0.1Hz 1Hz	40Hz~500Hz	±1%rdg±2dgt							
Measuring method	Earth resistance: Fall-of-potential method (currents and voltages measured via the Probes) Measurement method of Earth Resistivity (ρ): Wenner 4-pole method Series interference voltage (earth voltage): RMS Rectifier (between the E-S Terminals)										
Memory capacity	800 data										
Communication interface	Model 8212USB Optical Adaptor										
LCD	Dot-matrix 192×64, monochrome										
Over-range Indication	"OL"										
Overload Protection	between E-S(P) and between E-H(C) terminals AC280V / 10 sec.										
Withstand voltage	between the electrical circuit and enclosure AC3540V(50/60Hz) / 5 sec.										
Applicable standards	IEC 61010-1 CAT.III 300V, CAT.IV 150V Pollution degree 2 IEC 61010-031, IEC 61557-1,5, IEC 61326-1(EMC), IEC 60529(IP54)										
Power source	DC12V : sizeAA manganese dry battery (R6P) x 8 (Auto power off: approx. 5 minutes)										
Dimensions	167(L)×185(W)×89(D)mm										
Weight	approx. 900g (including batteries)										
Accessories	7229(Precision measurement test leads), 7238(Simplified measurement test leads), 8032(Auxiliary earth spikes [2 spiks/set])×2 sets (4 spikes in total), 8200-04(Cord reel [4 reels])×1 set , 8212-USB(USB adaptor with "KEW Report(Software)"), 9121(Shoulder strap), 9125(Carrying case), R6P×8, Instruction manual, Calibration certificate										
Optional		8212-RS232C(RS232C adapte	or with "KEW Report(Software)	8212-RS232C (RS232C adaptor with "KEW Report(Software)")							

*1: Auxiliary earth resistance is 100Ω with Rk correction

*2: Depending on the measured Rg. Interval [a] between auxiliary earth spikes is 1.0~30.0m

*3: This instrument is NOT designed to measure line voltages on commercial powers.

EVERYTHING YOU NEED.....

KEW4106 comes with everything you need for testing the Earth Resistance and Soil Resistivity.

A full set of accessories is included: four auxiliary spikes, four cable reels and four test leads(Red:40m, Yellow/Black/Green:20m) for Earth and Resistivity measurements. It is also supplied with particular test leads with relative probes and crocodile clips dedicated for simplified measurements. PC software for downloading and interpreting of data and an interface cable are included.

The instrument also comes in a soft carry case, a quick reference guide is attached to the case lid, and it is supplied with a calibration certificate.





Please read the "Safety Warnings" in the instruction manual supplied with the instrument thoroughly and completely Safety Warnings : for correct use. Failure to follow the safety rules can cause fire, trouble, electrical shock, etc. Therefore, make sure to operate the instrument on a correct power supply and voltage rating marked on each instrument.

For inquires or orders :

KYORITSU ELECTRICAL INSTRUMENTS WORKS, LTD.

No.5-20, Nakane 2-chome, Meguro-ku, Tokyo, 152-0031 Japan Phone:81-3-3723-0131

Fax:81-3-3723-0152 E-mail:info@kew-ltd.co.jp Factory: Ehime, Japan



http://www.kew-ltd.co.jp

KEW4106-1E Feb. 09 AD

